


LEYLAND-TRIUMPH SALES COMPANY, INC.

**WESTERN ZONE**

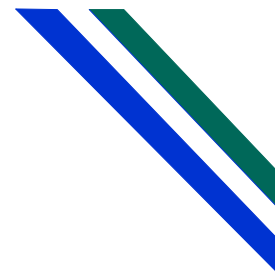

TO: ALL TRIUMPH DEALERS - WESTERN ZONE

DEPT: SERVICE DEPARTMENT

SUBJECT: TR-4A STEERING

BULLETIN T-65-22

DATE: MAY 6, 1965

---

This bulletin is to advise you that the TR-4A lower steering trunnion is to be lubricated exactly the same as the 1200 and Spitfire.

For example, there is a plug in the lower trunnion which has to be removed and a grease nipple inserted. Lubrication at this point is Hypoid 90 weight oil. It is in order to allow the oil to seep out at the time of lubrication at the trunnion joints. After lubrication the grease nipples are to be removed and the plug replaced. No other lubrication is to be used at the point, otherwise damage will be caused to the threaded portion of the lower trunnion assembly and a stiff steering effect will result.